


Refilling Instructions

for Canon BC-05 Tri-Color Cartridges

Contents: 1 Cyan Dispenser 15cc • 1 Magenta Dispenser 15cc • 1 Yellow Dispenser 15cc
Fill Plug Removal Tool


1. Cover work area with a few layers of newspaper or paper towels.
2. Before removing the empty cartridge from the printer run a test print to determine which of the three colors requires refilling. **Do not fill a color chamber until it is completely depleted.**
3. Remove the cartridge from the printer. (Important: While handling the print cartridge DO NOT touch the printhead and DO NOT rest the cartridge directly on the print head - this can cause damage to the print head or cause it to leak.)
4. Locate the three fill hole plugs on cartridge (see Illustration 1). Using the tool provided, drill completely through one of the plugs and into the ink chamber. COMPLETELY REMOVE the plug by pulling upward on the tool like a corkscrew (see Illustration 1a). Repeat the plug removal procedure for the other two fill holes.

Note: Each plug has two small holes - be sure to drill through the smaller (outer) hole to achieve grip necessary to remove the plug. The plugs may be discarded; they are no longer needed.

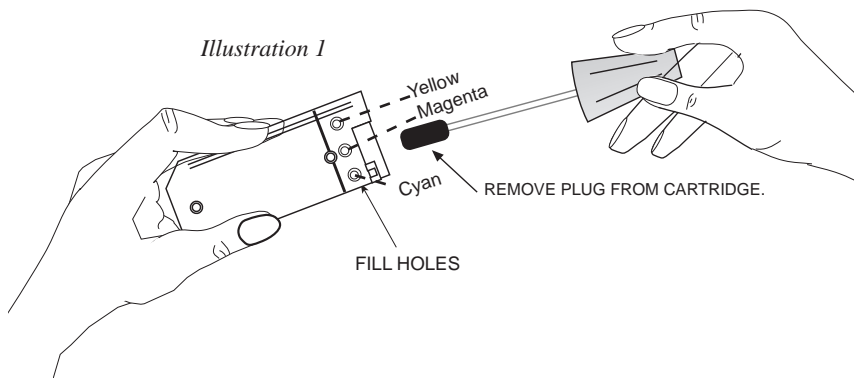


The BJC-210 and BJC-240 also can use the BC-02 black cartridge.
To refill this use Repeat-O-Type Refill Ink System™ BC-01R.

5. Take the refill bottle corresponding to the color of ink that is depleted and remove the scabbard from the filler tube. Holding the print cartridge in your hand, carefully insert the filler tube as far as it will go. Then draw it back about 1/4" (6 mm) (Illustration 2).

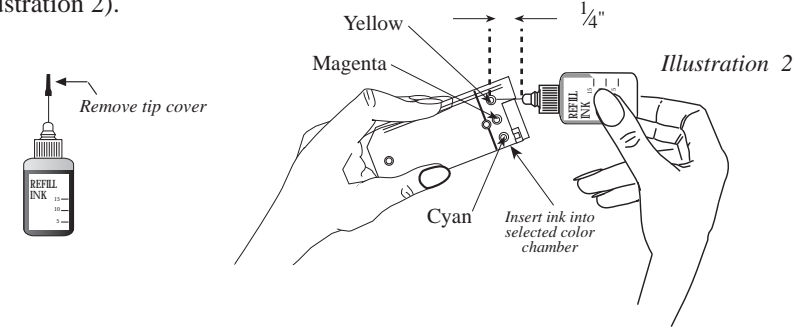

6. Tilt the bottle and cartridge until the filler tube is in the fully inverted position (Illustration 3). Gently squeeze the bottle until 5cc of ink is dispensed into the cartridge.

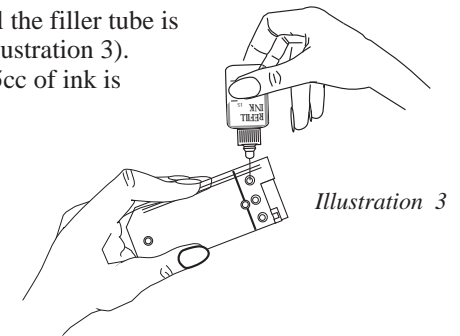

7. Bring the bottle back to the position shown in Illustration 2 (filler tube in horizontal position). Remove the refill bottle. Recap the bottle and save for future use. Blot up any residual ink around the fill hole with a tissue. Allow a few minutes for the ink to rewet the print head.
8. Reinstall the cartridge into the printer. Perform the printhead cleaning procedure following the instructions outlined in your printer instruction booklet.

The BC-05 Cartridge can be refilled several times. Eventually the printhead will wear out. When the print quality deteriorates, replace the old cartridge with a new one.

REPEAT-O-TYPE
MANUFACTURING CORPORATION
ESTABLISHED 1931

665 State Highway 23 • Wayne, NJ 07470-6892 U.S.A. • (973) 696-3330 • (800) 288-3330
Fax: (973) 694-7287 • E-mail: help@repeatotype.com

Canon is a trademark of Canon, U.S.A. Inc.
©1999 Repeat-O-Type Manufacturing Corporation.