

Refilling Instructions

for **Canon BCI-21** and **Apple M3329G/A** Black Ink Cartridges
used in **Canon BJC-4000** and **Apple Color StyleWriter 2400** Printers

1. Make sure cartridge is really out of ink.

When cartridge appears to have run out of black ink, run printer cleaning cycle and then run a test print to verify that the black chamber is completely empty.

2. Remove black ink cartridge from printhead unit.


Open front cover of printer then press and hold "CARTRIDGE" button until printer beeps. Printhead unit will soon come to rest at center of carriage. Snap black ink cartridge out of its holder. (It is not necessary to remove the entire printhead unit.)

3. Protect work surface.

Refilling your cartridge is a clean and simple job, but it is best to cover your work area with newspaper or other scrap paper to protect from accidental ink spills.

4. Refill cartridge.

Unscrew dropper bottle cap and squeeze rubber bulb to fill dropper tube with ink. (Each squeeze of the bulb will withdraw 0.75ml of ink from the bottle.) Withdraw dropper from the bottle and gently touch dropper tip to black cartridge ink port. (See Fig. 1) Slowly dispense ink by gently squeezing rubber bulb, allowing ink to be absorbed into the ink pad. Repeat this procedure, filling dropper nine (9) more times so that a total of 7.5ml* of ink is dispensed (10 x 0.75ml = 7.5ml).

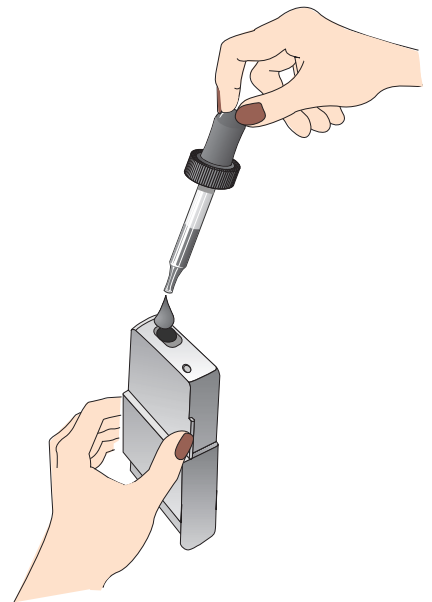

5. Recap ink bottle and reinstall filled cartridge in the printhead unit.

Save remainder of ink for future use.

IMPORTANT: Do Not Overfill

If more than 7.5ml of ink is added, ink may leak from a hidden air vent and drip from back of cartridge.

***Note:** Although a new Canon BCI-21 black ink cartridge contains 9ml of black ink, it stops printing before all of the ink is used. This is the reason for adding only 7.5ml of ink each time you refill.

In the unlikely event that ink gets on your fingers, it can easily be removed by moistening a paper towel with a solution of laundry bleach diluted with an equal amount of water. Be sure to wash hands thoroughly after using bleach solution.

IF YOU HAVE ANY QUESTIONS OR ENCOUNTER ANY DIFFICULTY IN USING THIS PRODUCT, PLEASE CONTACT:

REPEAT-O-TYPE
MANUFACTURING CORPORATION
ESTABLISHED 1931

665 State Highway 23 • Wayne, NJ 07470-6892
(973) 696-3330 • (800) 288-3330 • Fax (973) 694-7287