
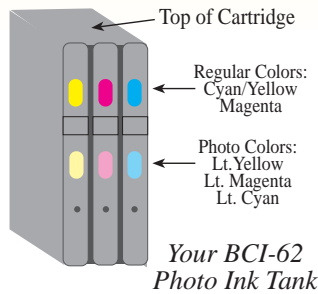


Photo Ink Kit Refill Instructions

For Canon BCI-62 6-Color Photo Ink Tank
Contents:

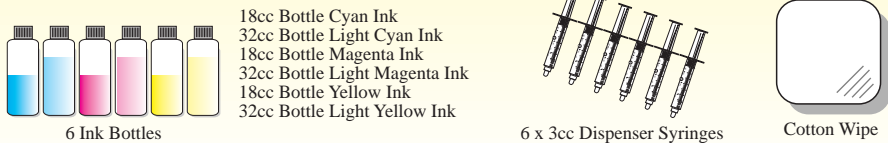


Refilling your cartridge is a clean and simple job, but it is advisable to cover your work area with scrap paper to protect from accidental spills.

Note: Empty chambers should be refilled as soon as they run out of ink to prevent the small amount of ink remaining in the cartridge from drying and hardening in the sponge.

1. Determine which of the six colors of ink are depleted by running a test print.



2. Remove the BCI-62 ink tank from the BC-62 cartridge and place on the table with the six ink ports facing up. See Figure A.

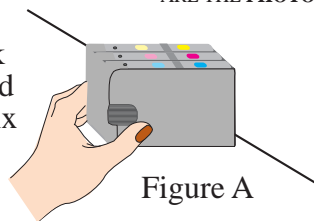


3. Uncap the ink bottle containing the color of ink that has been depleted.

FOR CYAN, MAGENTA AND YELLOW CHAMBERS:

4. Fill a syringe with 3cc of ink. See Figure B.

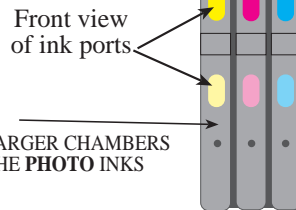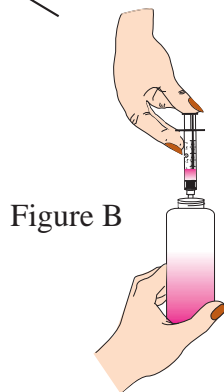

5. GENTLY touch the tip of the syringe to the ink port requiring refilling and slowly dispense the ink. If the ink starts to well up, stop filling and allow time for it to soak in. Be careful to prevent ink from flowing over to one of the other ports. Stop filling if the port refuses to absorb more ink. See Figure C.

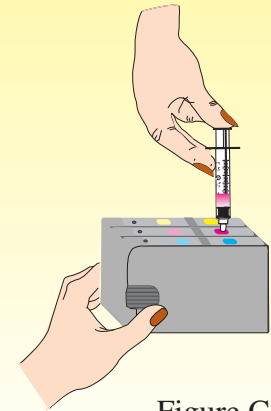

IMPORTANT NOTE:

Do not allow colors to run from 1 port to another.

FOR LIGHT CYAN, LIGHT MAGENTA AND LIGHT YELLOW CHAMBERS:

Follow the same procedure as described above, but dispense TWO 3cc syringes full of ink into the chamber that is empty.

6. Recap the ink bottle and save for future use.

7. Snap the ink tank back in the BC-62 cartridge. Reinstall in the printer and run a few cleaning cycles and a test print.

DO NOT REFILL ANY OTHER COLOR CHAMBER UNTIL IT IS DEPLETED!

IF YOU HAVE ANY QUESTIONS OR ENCOUNTER ANY DIFFICULTY IN USING THIS PRODUCT, PLEASE CONTACT:

REPEAT-O-TYPE
MANUFACTURING CORPORATION
ESTABLISHED 1931

665 State Highway 23 • Wayne, NJ 07470-6892 U.S.A. • (973) 696-3330 • (800) 288-3330
Fax: (973) 694-7287 • Email: help@repeatotype.com